

歐品電子(昆山)有限公司

OUPIN ELECTRONIC(KUNSHAN) CO.,LTD.

PACKAGING SPECIFICATION (包 裝 作 業 規 范)

☒ CONFIDENTIAL ☐ TOP SECRET

SPEC.NO.(规范編號)	Q9391SPP-878							PAGE	1/4	REV.	E
APPLICABLE CUSTOMER (適用客戶)	ALL	APPLICABLE PRODUCT (適用產品)	9391-A1P04S24P04CB30xxA(-Axxx)	9391-A1S24P08CB30D(P)LA	9391-A1P08S24CB30D(P)LA			PACKAGING CATEGORY (包裝方式)		TRAY PLATE PACKING	

REVISION HISTORY (修 訂 履 歷)

REV.	ECN NO	PAGE (頁 次)								
		1	2	3	4					
A		New Issue 新版發行								
B		Revise material number 修改料號								
C		Add P/N 新增料號								
D		1.Add P/N2. Poly Dragon has been updated to Air column bag. 3. Batch labels have been added 1.新增料號 2.保利龙更新为气柱袋 3.增加批次标签								
E		Add P/N 新增料號								

DIVISION (事業單位)	Product Development (產品開發課)	APPROVED (核 准)		CHECKED (審 核)	DE: PE:	PREPARED (制 表)	XS 04/10'26
-----------------	-----------------------------	----------------	--	---------------	---------	----------------	-------------

歐品電子(昆山)有限公司

OUPHIN ELECTRONIC(KUNSHAN) CO.,LTD.

PACKAGING SPECIFICATION (包裝作業規範)


SPEC.NO.(規範編號) Q9391SPP-878

☒ CONFIDENTIAL ☐ TOP SECRET	
PAGE	2/4
REV.	E

PACKING OPERATION DIAGRAM & INSTRUCTION (包裝作業圖示及說明)

REMARK (備 注)

Laying Product Diagram:
(產品擺放圖示)

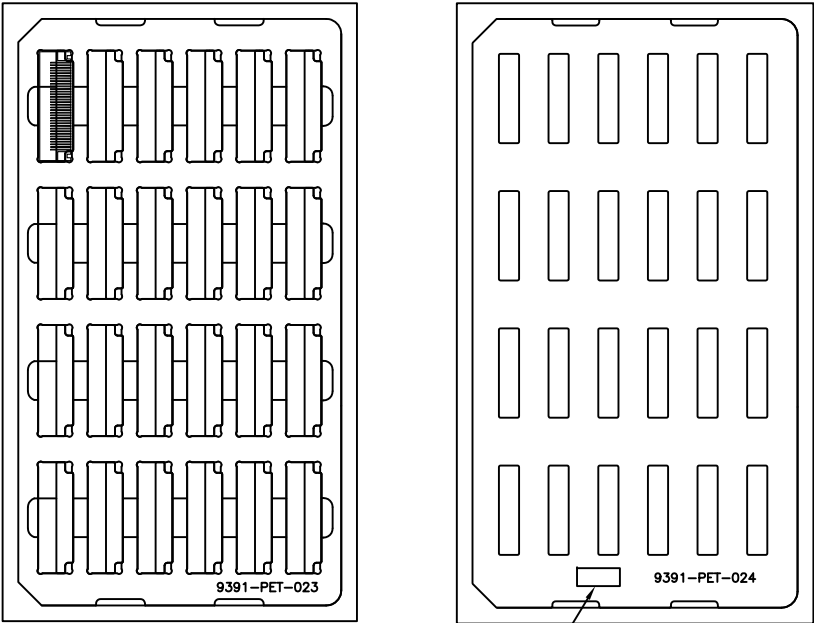

(Drawing 1)
(圖1)

- 一.PET Plate Packing Mode:
(PET盤包裝方式)
- (1).CT-0.5 Box,9391-PET-023 XX PCS.
(CT-0.5 規格的紙箱放盤9391-PET-023 XX PCS)
- (2).Put product in each trough fully as shown in diagram.
(產品在盤子中擺放方式如圖所示)
- (3).After filling each trough with product fully,cover it with transparent upper cover 9391-PET-024 1PCS 。
The cover should be stapled together with the chassis using a stapler, so as not to cause the products to fall scattered.
每盤放滿產品後,加蓋透明上蓋 9391-PET-024 1PCS
蓋子要與底盤用订书机订在一起, 以免造成產品散落
- (4)The label of batch label is stuck on each cover (such as Fig. 1).
在每個蓋子的上面貼批次標籤(如圖1)
- (5).Stack the XX PET plates filled with product, put them in the paper box in which has been put waterproof bag.
(將放滿產品的XX個PET盤疊起,裝入防水袋放入紙箱內)

歐品電子(昆山)有限公司

OUPIN ELECTRONIC(KUNSHAN) CO.,LTD.

PACKAGING SPECIFICATION (包裝作業規範)

SPEC.NO.(規範編號) Q9391SPP-878

☒ CONFIDENTIAL ☐ TOP SECRET

PAGE


3/4

REV.

E

PACKING OPERATION DIAGRAM & INSTRUCTION (包裝作業圖示及說明)


REMARK (備 注)

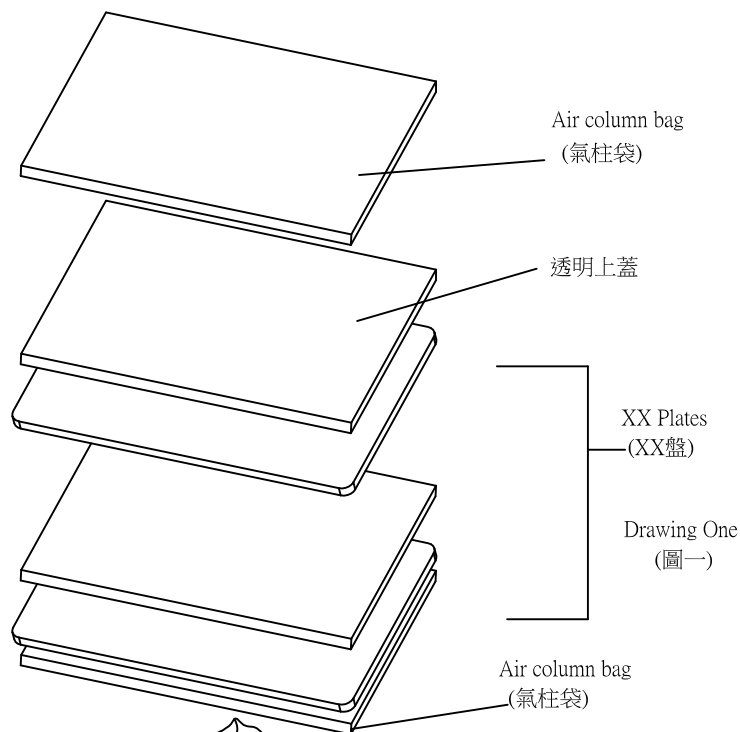


XX Plates
(XX盤)

Drawing One
(圖一)

Air column bag
(氣柱袋)

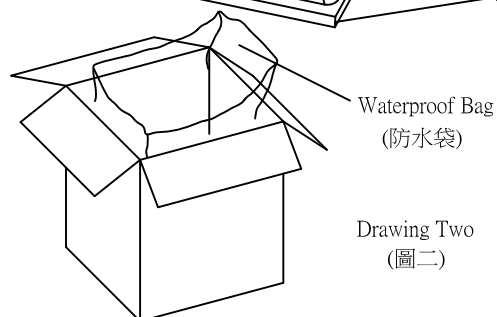

Drawing Two
(圖二)

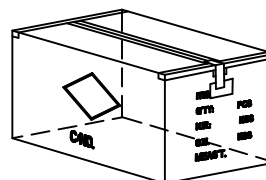

Drawing Three
(圖三)

一. Outer Box Packing Mode:

(外箱包裝方式)

- (1). Paper box 0.5 standard 1 PCS, as shown in drawing Two.
(紙箱0.5規格 1 PCS, 如(圖二)所示)
- (2). Put one Air column bag in the upper and lower of the paper box, 2PCS in all, as shown in drawing One.
(每箱上下各放一塊氣柱袋, 共2PCS, 如(圖一)所示)
- (3). Put 1 PCS waterproof in the paper box, as shown in drawing Two.
(紙箱內側放入防水袋 1 PCS, 如(圖二)所示)
- (4). Piled the XX packing plates packed up in the waterproof.
(將放滿產品的XX個PET盤疊起, 裝入防水袋內)
- (5). Seal the waterproof bag, then put the Air column bag 1PCS on the bag.
(Put 1 PCS Air column bag at the right and left side in the paper box if it is necessary.)
(封上防水袋, 然後放上第二塊氣柱袋)
(必要時, 在紙箱的左右兩側各放一塊氣柱袋)
- (6). Seal the surface of the outer box, as shown in drawing Three.
(將外箱上層封口, 如(圖三)所示)

The form on the right and flank side of the box must be filled correctly and clearly, take actual testing weight as the standard of each box gross weight.

外箱之正麥和側麥所要填寫之項目要填寫正確, 清晰, 每箱之毛重應以實測重量為準.

歐品電子(昆山)有限公司

OUPIN ELECTRONIC(KUNSHAN) CO.,LTD.

PACKAGING SPECIFICATION (包 裝 作 業 規 范)

CONFIDENTIAL TOP SECRET

SPEC.NO.(规范编号)	Q9391SPP-878								PAGE:	4/4	REV.	E
PACKING MATERIAL (包 裝 材 料)			PRODUCT P/N	CT NO.	PACKING N.W.	PACKING QUANTITY (包装数量)			WEIGHT (重 量) kg			
MATERIAL NAME (材料名称)	PART NO. (料 號)	Q'TY	(產品料號)	(紙箱規格)	(包材重量)	PCS/TRAY	TRAY/BOX	PCS/BOX	N.W./PCS	N.W./BOX	G.W./BOX	
PAPER BOXES (紙箱)	CT-0.5	1	9391-A1P04S24P04CB30xxA(-Axxx)	CT-0.5	2.63	24	4	96	0.036825	3.54	6.16	
Packing Box (包裝盒)	9391-PET-023	----	9391-A1S24P08CB30D(P)LA	CT-0.5	2.63	24	4	96	0.036825	3.54	6.16	
Packing Box Cover (包裝盒蓋子)	9391-PET-024	----	9391-A1P08S24CB30D(P)LA	CT-0.5	2.63	24	4	96	0.036825	3.54	6.16	
WATERPROOF BAG (防水袋)	PE 100*70	1										
Air column bag(氣柱袋)	-----	2										
DRYING AGENT (干燥劑)	-----	3										

1.NOTE:
(注意)
When the finished products have been made,take the actual weight as the standard of gross weight in each box.
(成品出貨時,每箱之毛重應以實測重量為準)
When the finished products have been made,stick the proper designation list on the box according to product demand.
(成品出貨時,依據出貨要求貼上相對應的標籤單)